

## LCD TELEVISION TECHNICAL BULLETIN


<b><u>MODELS</u></b>	LC32SA1E LC32BT8E	LC32SD1E	LC32GA8E	LC32GD8E
----------------------	----------------------	----------	----------	----------

**SYMPTOM** Backlight intermittently shuts down leaving sound on.

**CAUSE** Poor earth contact on Inverter panel.

**ACTION** Replace all 6 fixing screws with the improved type.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
-	M3 x 7mm screw with spring washer	LX-BZ2315TPZZ	AC

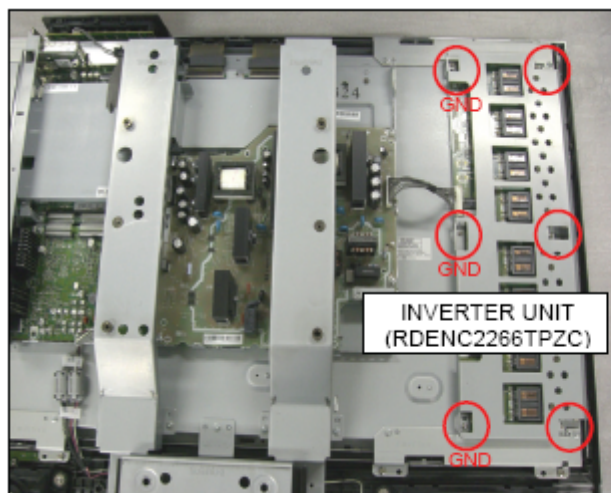

Procedure:  
Change the 6 screws to LX-BZ2315TPZZ.



OLD PARTS:  
LX-BZ2090TPZZ  
M3 x 6mm



NEW PARTS:  
LX-BZ2315TPZZ  
M3 x 7mm  
φ 8 washer

(Do NOT reuse the removed old screws.)

**Sharp Electronics (UK) Limited**

Reference – LV260  
Revision - 1

White – Carry out as required  
Yellow – Carry out as required and whenever the unit comes in for service  
Red – Carry out on all units